

Work Order ID 62047

Wednesday, September 15, 2010 11:16:52 A



Page 1

Item ID: D2580-1

Accept



Setup Start



Revision ID:

Stop



Item Name: 205 Skidtube bent detail

Start Date: 9/15/2010 Start Qty: 2.00



Cust Item ID:

Required Date: 9/22/2010 Req'd Qty: 2.00



Customer:

Reference:

Run Start

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 62047

Wednesday, September 15, 2010 11:16:52 A



Page 2

Item ID: D2580-1

Accept



Setup Start



Revision ID:

Stop



Item Name: 205 Skidtube bent detail

Start Date: 9/15/2010 Start Qty: 2.00



Cust Item ID:

Required Date: 9/22/2010 Req'd Qty: 2.00



Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start



Stop



Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

110

0.00



Skidtubes

Memo

0.00

1-Drill pilot holes using drill jig DT 8149 (Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580 without cutting fluid

3-Deburr and blow out all chips from inside of tube

4-Bond web in place per QSI 015.

□□

A/R Sikaflex-291 batch: M115114 □□□

Sikaflex expire date: 11-1-30

Start time and date: 3:30pm 10-9-22 bond for 12hrs

BB 10/09/21

(X2)

> DP 10-9-22

130

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

S 10/09/23

(X2)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 62047

Wednesday, September 15, 2010 11:16:52 A

Page 3

Item ID: D2580-1

Accept

Revision ID:

Item Name: 205 Skidtube bent detail

Start Date: 9/15/2010 Start Qty: 2.00

Required Date: 9/22/2010 Req'd Qty: 2.00

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run

Start

Stop

Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

Identify as per dwg & Stock Location: L6

0.00



Packaging

Memo

0.00

Packaging

150

QC21- Final Inspection - Work Order Release

0.00



QC

Memo

0.00

Quality Control



Setup Start



Stop



Cust Item ID:

Customer:



DP 10-9-23

(2)

10/09/27/09

MF

10-9-23

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Wednesday, September 15, 2010 11:16:56 AM

Page 1

Work Order ID: 62047



Parent Item: D2580-1



Parent Item Name: 205 Skidtube bent detail

Start Date: 9/15/2010

Required Date: 9/22/2010

Start Qty: 2.00

Required Qty: 2.00

Comments: IPP B01.11.08 Revised Step 9, 10, 12, and 13 SM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190

Manufactured

No

Each

96.0000

1

2



Ext'n - I' Beam Tube 4"

Location

Loc Qty

Loc Code

LG

96

52319

23

58427

73

②

BB 10/09/21

D2596

Manufactured

No

110

Each

2.0000

1

2



Web, 205 Skidtube

Location

Loc Qty

Loc Code

LG46

2

61638

2

②

BC2192

DP 10-9-22

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN <i>[Signature]</i>	DRAWN BY <i>RH</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

RELEASED
07-06-28 *[Signature]*

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

SHOP COPY

TO
BUILDING
COPY
ORDER
*60047**R/10-9-85***GENERAL NOTES:**

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:
SEE NOTES ON
PAGE 2 FOR D2580-041 AND
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

Copyright © 1996 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


DETAIL A
SCALE 5:24

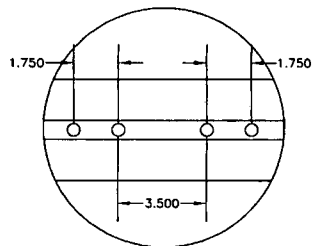


DETAIL B
SCALE 5:24

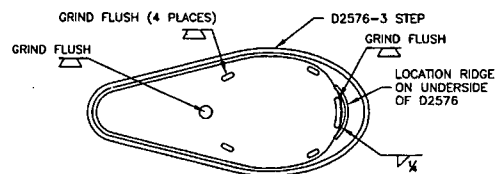


D2580-1 DRILLING DETAIL

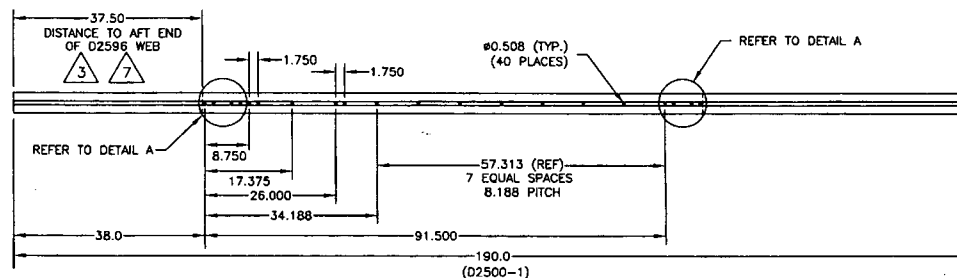



D2580-1 BENDING AND CUTTING DETAIL

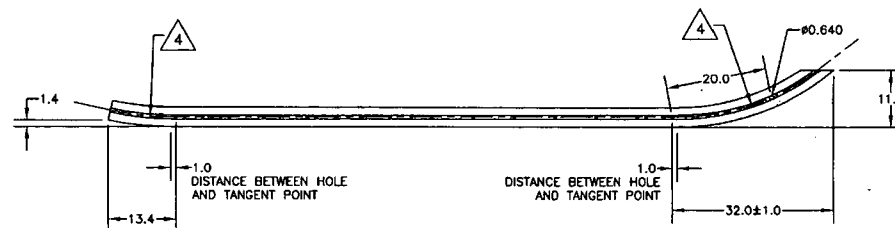

D2580-041 ASSEMBLY DETAIL

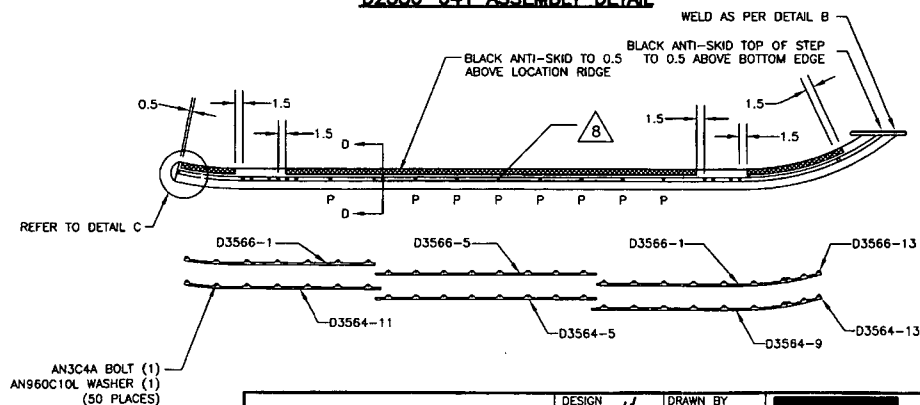

SECTION D-D
SCALE 5:24

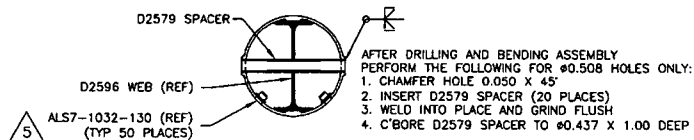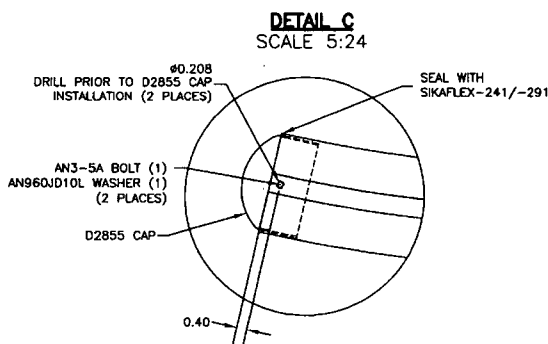

D2580-041 NOTES

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

COPYRIGHT © 1996 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	DRAWN BY	DART	DART AEROSPACE LTD.
CHECKED	APPROVED	DRAWING NO.	REV. D
DATE		D2580	SHEET 2 OF 3
07.02.27		TITLE	SCALE
		205 SKIDTUBE ASSEMBLY	1:24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

RELEASED
07-16-28

Diagram illustrating the grinding locations for the propeller cross-section. The diagram shows a cross-section of a propeller with the following labels and features:

- GRIND FLUSH (4 PLACES)**: Indicated by four small circles on the outer edge of the propeller.
- GRIND FLUSH**: Indicated by a small circle on the inner edge of the propeller.
- D2576-3 STEP**: Indicated by a line pointing to the step on the inner edge of the propeller.
- LOCATION RIDGE ON UNDERSIDE OF D2576**: Indicated by a line pointing to the ridge on the underside of the propeller.
- 1/8"**: A dimension line indicating the thickness of the propeller at the bottom.

#0.208
DRILL PRIOR TO D2855 CAP
INSTALLATION (2 PLACES)

SEAL WITH
SIKAFLEX-241/-291

AN3-SA BOLT (1)
AN960JD10L WASHER (1)
(2 PLACES)

SEE NOTE ii)

D2855 CAP

0.40

D2579 SPACER

D2596 WEB (REF)

ALS7-1032-130 (REF)
(TYP 50 PLACES)

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C-BORE D2579 SPACER TO 0.437 X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB
POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE
WITH THE SPACER AT THIS LOCATION

37.50
DISTANCE TO AFT END
OF D2596 WEB

3
7

1.750 1.750

#0.508 (TYP.)
(40 PLACES)

REFER TO DETAIL E

REFER TO DETAIL A

8.750
17.375
26.000
34.188

57.313 (REF)
7 EQUAL SPACES
8.188 PITCH

38.0 91.500

190.0
(D2500-1)

WELD AS PER DETAIL F

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

NO C'BORE NO PLUG

8

NO C'BORE NO PLUG

D3566-1

D3566-5

D3566-1

D3566-13

D3564-11

D3564-5

D3564-9

D3564-13

AN3C4A BOLT (1)


AN96OC10L WASHER (1)

(50 PLACES)

DESIGN	DRAWN BY	CHECKED BY

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE LTD.

DRAWN BY	RH
APPROVED	[Signature]

 DART AEROSPACE LTD. HAWKSBURY, ONTARIO, CANADA	
DRAWING NO.	REV. D
D2580	SHEET 3 OF 3
TITLE	SCALE
205 SKIDTUBE ASSEMBLY	1:24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries